

1 Products affected

Product hierarchy no. *				Part no.	SBU	Type / Description	Customer part no.
SBU	PG	PUG	Type				
02	005	016	0000001103	See list below	Power Entry Modules w/o Filter	6200	

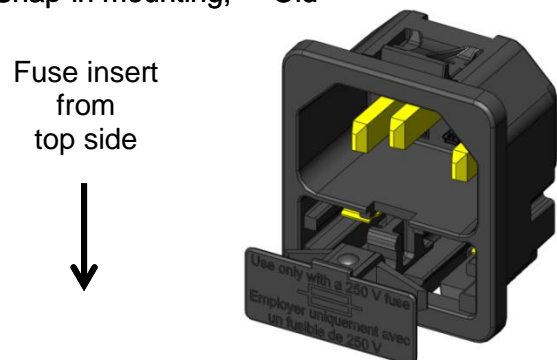
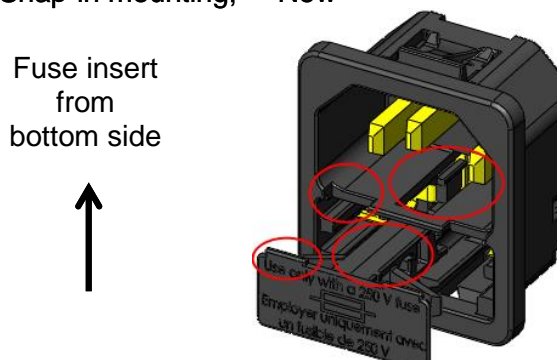
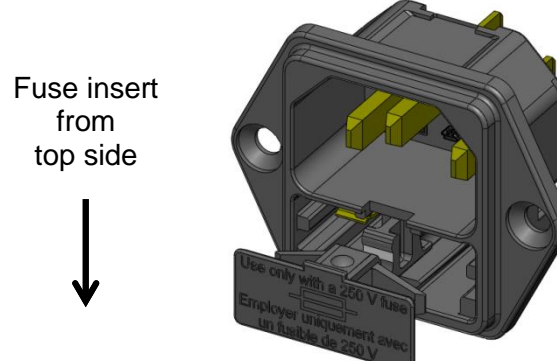
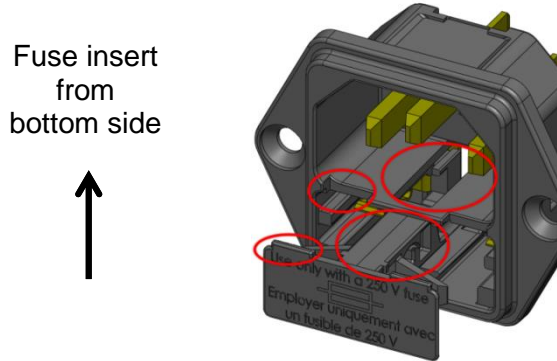
*SBU (2-digit) / PG (3-digit) / PUG (3-digit) / Type (10-digit)

List of part numbers affected				
6200.2100	6200.2200	6200.2300	6200.4110	6200.4112
6200.4115	6200.4120	6200.4125	6200.4130	6200.4210
6200.4212	6200.4215	6200.4220	6200.4225	6200.4230
6200.4310	6200.4312	6200.4315	6200.4320	6200.4325
6200.4330	6200.9100	6200.9200	6200.9300	

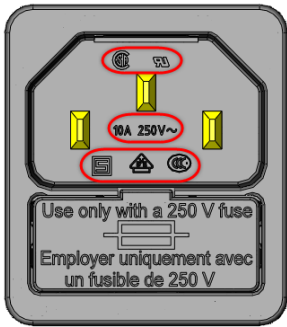
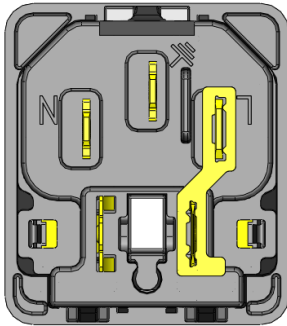

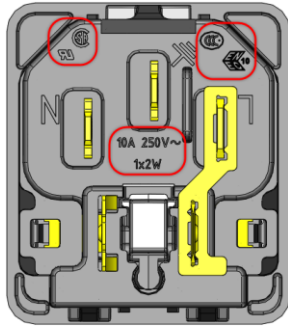
2 Type of change

1. V-Lock cord retaining integrated as standard
2. Material change
3. Modification of approval marks

3 Detailed description of change

Old product appearance		New product appearance	
<ul style="list-style-type: none"> - Slot for V-Lock cord retention - Fuse assembling from opposite side - Fusedrawer has two latches on the side to pull-out the fusedrawer, until now is only one latch 			
Snap-in mounting; Old Fuse insert from top side 	Snap-in mounting; New Fuse insert from bottom side 		
Screw-on mounting; Old Fuse insert from top side 	Screw-on mounting; New Fuse insert from bottom side 		

Product Change Notification					PCN 6200		
owner	creation date	release date	released by	change order no	rev	page	D10-004-681
schaidro	2016-05-30	2016-12-06	buerglal	2011605	A	1 of 2	

Old product approval marks	New product approval marks
<p>Picture shows snap-in mounting, change also applies to screw version. All approval and rating marks are new on the rear side</p>	
<p>Old;</p>  	<p>New;</p>  

4 Reason of change

- V-Lock cord retaining implemented as a standard feature
- VDE mark replaced by ENEC10
- Product improvement to fulfil the enhanced glow wire requirements according to the updated standard IEC 60127-6 and the standard IEC 60335-1 for appliances in unattended use.

5 Release date

The change will be rolled-out starting ww 47/2016 and lasts approx. 8 months depending on the variant.

6 Impact of change and recommended action

Form	Yes	- Slot (notch) for V-Lock cord retention - Insertion of the fuse is turned - Fusedrawer has 2 latches sideways
Fit	No	No dimensional change
Function	Yes	Compatible with V-Lock cordsets
Production Site	No	No change of the production site
Product Label	Yes	VDE mark replaced by ENEC10
Customer Action	No	Notification only

7 Reference Documents / Attachments

Kind of document	Remarks
6200	Datasheet

Product Change Notification						PCN 6200	
owner	creation date	release date	released by	change order no	rev	page	D10-004-681
schaidro	2016-05-30	2016-12-06	buerglal	2011605	A	2 of 2	